



STEP 1

- Remove loose or failing bank material.
- Excavate a trench into bank (4–9” depth).
- Trench should extend to below reliable low water.

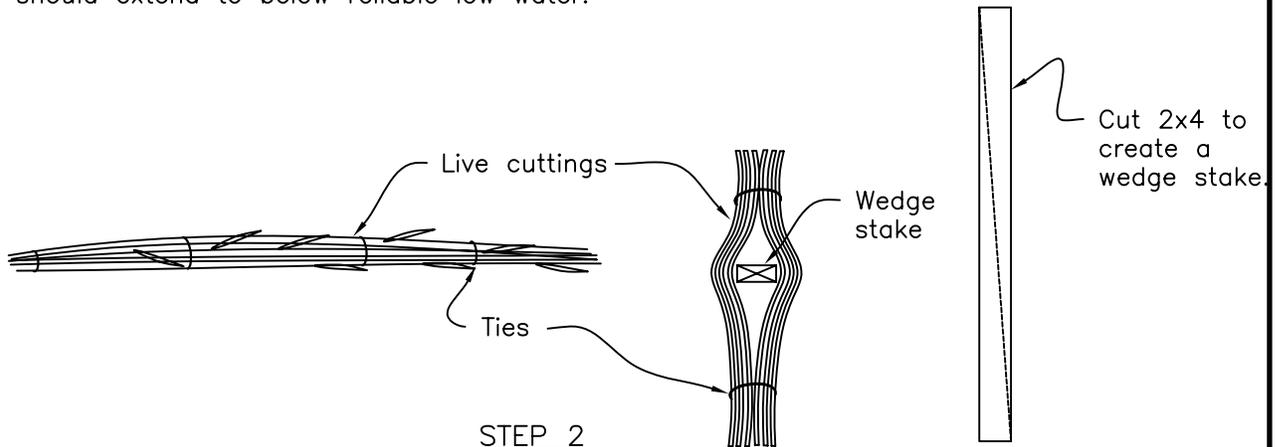

STEP 2

- Assemble bundles of live cuttings. Use a minimum of 4 cuttings per bundle.
- Orient all cuttings in one direction.
- Tie cuttings at 2 to 3 ft intervals.
- Place a bundle in trench and stake with 2 to 3 wedge stakes between ties.

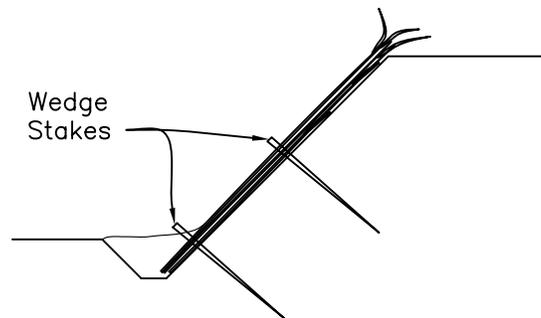

- Refill bottom of trench.
- Wash loose soil into cuttings. Approximately  $\frac{1}{2}$  to  $\frac{3}{4}$  of bundle should be covered.
- Trim terminal buds of cuttings.
- Irrigate as necessary.

**Conceptual Plan - Not for Construction**

N.T.S.



Vertical Bundles

Designed	J. Fripp K. Worster	Date	01/06
Drawn	J. Renteria	Date	01/06
Checked	_____		
Approved	_____		

File Name	Vertical Bundles.dwg
Drawing Name	Bundles
	01/24/07
Sheet	1 of 1